

Landmark Aviation

Reg #: N6188M
AC S/N: TH-1318

Make: Beech
ACTT: 4273

Model: 58
Hobbs: 1027.8

Tach: N/A

Airframe

Complied with Annual Inspection in accordance 14CFR 91.409(a)(1).

Complied with Annual ELT Inspection in accordance with 14CFR 91.207(d). Installed new battery, next due 9/2014.

Complied with AD research thru biweekly 2012-19.

Complied with AD 90-08-14 wing spar carry thru inspection dated 5/7/1990, paragraph (a)(1). No defects noted. Next due at 4773.0 ACTT, 1527.8 Hobbs time.

AD 2012-03-06 is not applicable.

AD 2012-10-02 is not applicable by aircraft serial no.

AD 2011-27-04 is not applicable by STC status.

Complied with AD 91-15-20, no defects noted. Next due at 4373.0 ACTT.

Complied with AD 2004-21-05, heater decay test. Next due 9/2014 or 1584.9 heater hobbs.

Complied with AD 76-07-12 R1, Bendix ignition switch test. Next due by 4373.0 ACTT.

Complied with wing bolt retorquing.

Installed STC SA02676CH, SRS Aviation Ice Protection Plates.

Installed new main ship batteries, G-25, serial nos. G02728438, and G02738492.

Installed new seals in left and right fuel selector valves.

Repaired left and right engine baffling as needed.

Installed new cable clamp for left gear downlock.


All work performed IAW current FAA regulations and current manufacturers technical data. The article is airworthy with respect to the work above.
For details of work performed, see workorder on file with this Repair Station.

Signature:

For Landmark Aviation CRS EASR436D
211 Tuskegee Road
Syracuse, NY 13211

Date: 09/29/2012

Work Order: S32-12-01106

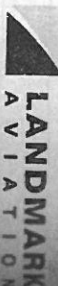

Landmark Aviation

Reg #: N6188M
AC S/N: TH-1318

Make: Beech
ACTT: 4322.0

Installed new lamp for right landing light.

All work performed IAW current FAA regulations and current manufacturers technical data. The article is airworthy with respect to the work above.
For details of work performed, see workorder on file with this Repair Station.

Signature:

For Landmark Aviation CRS EASR436D
211 Tuskegee Road
Syracuse, NY 13211

Landmark Aviation

Reg #: N6188M
AC S/N: TH-1318

Make: Beech
ACTT: 4348.5

The tests and inspections required by 14CFR 91

14CFR 43, appendix E and F to an altitude of

All work performed IAW current FAA regulations and current manufacturers technical data. The article is airworthy with respect to the work above.
For details of work performed, see workorder on file with this Repair Station.

Signature:

For Landmark Aviation CRS EASR436D
211 Tuskegee Road
Syracuse, NY 13211

del: 58
bs: 1027.8
Tach: N/A
Airframe

409(a)(1).
14CFR 91.207(d). Installed new battery, next due 9/2014.
dated 5/7/1990, paragraph (a)(1). No defects noted. Next

4373.0 ACTT.
9/2014 or 1584.9 heater hobs.
Next due by 4373.0 ACTT.

ates.
8438, and G02738492.

worthy with respect to the work above.

Date: 09/29/2012
Work Order: S32-12-01196



Landmark Aviation

Reg #: N6188M
AC S/N: TH-1318
Make: Beech
ACTT: 4322.0

Installed new lamp for right landing light.

All work performed IAW current FAA regulations and current manufacturers technical data. The article is airworthy with respect to the work above.
For details of work performed, see workorder on file with this Repair Station.

Signature: [Signature]
For: Landmark Aviation CRS EASR436D
211 Tuskegee Road
Syracuse, NY 13211

Date: 05/21/2013

Work Order: S32-13-01453

Airframe

Tach: N/A

Landmark Aviation

Reg #: N6188M
AC S/N: TH-1318
Make: Beech
ACTT: 4348.5

Model: 58
Hobbs: 1103.3

The tests and inspections required by 14CFR 91.411 and 91.413 have been performed in accordance with
14CFR 43, appendix E and F to an altitude of 20,000 feet.

All work performed IAW current FAA regulations and current manufacturers technical data. The article is airworthy with respect to the work above.
For details of work performed, see workorder on file with this Repair Station.

Signature: [Signature]
For: Landmark Aviation CRS EASR436D
211 Tuskegee Road
Syracuse, NY 13211

Date: 10/07/2013

Work Order: S32-13-01610

Airframe

Tach: N/A



Reg #: N6188M
AC S/N: TH-1318

Model: 58
Hobbs: 1103.3

Airtrame

Tach: N/A

Complied with Annual Inspection in accordance 14CFR 91.409(a)(1).
Complied with Annual El T Inspection in accordance with 14CFR 91.409(a)(1).

Complied with Annual ELT Inspection in accordance with 14CFR 91.207(d),
Installed ARTEX ME-406 ELT IAW Artex install manual 25.63.30. Part 1

ELT battery expiration date is OCT 2020.

Complied with AD research thru biweekly 2013-20.

Complied with AD 91-15-20, no defects noted. Next due at 4448.5 ACFT.

Complied with AD 76-07 13 B1. No defects noted. Next due at 4448.5 ACTT.

Installed overhauled Aspen EFD 1000 part no. 010.0000.4.004. Next due by 4448.5.0 ACTT.

Installed new induction filters on left and right engines

installed new vacuum regulator and central filters.

Cleaned battery box and repainted with acid resistant paint

Installed new linings on left and right brakes.

Installed new breather hose on right engine.

All work performed IAW current FAA regulations and current manufacturers technical data. The article is sinworthy with respect to the work above. For details of work performed see workorder on file with this Repair Station.

Signature: _____

ark Aviation CRS EASR436D

Date: 10/07/2013

Work Order: S32-13-01610



Syracuse,

[illegible]

Service Information

Service Bulletins and Technical Publications are available on a direct mail basis from the factory. Orders must be prepaid. Send for order form or call 334-438-3411, publications department, for information.

Engine Returns

All returned engines are to be shipped with this log book Directly to:

Teledyne Continental Motors
Abbeville Industrial Park
Suite 159
Abbeville, AL 36310

USE ONLY FUEL CONFORMING TO ASTM D910
USE OF AUTOMOTIVE GAS IS NOT APPROVED.



Teledyne Continental Motors, Inc.
A Teledyne Technologies Company

Printed: 05/22/2004

This engine model I0520CB9F , Serial No. 831669 - R was manufactured on 05/21/2004 by Teledyne Continental Motors in accordance with approved design data and the applicable requirements of Part 21 of the Federal Aviation Regulation. The approved design data for this engine incorporates all changes required by applicable Airworthiness Directives and Teledyne Continental Motors Service Bulletins.



TELEDYNE CONTINENTAL MOTORS

A TELEDYNE TECHNOLOGIES COMPANY

PRODUCTION CERTIFICATE NO. 508

Landmark Aviation

Right Engine

Reg #: N6188M
AC S/N: TH-1318
E2 M/N: IO-520-CB

Make: Beech
ACTT: 831669R
E2 S/N: 831669R

Model: 58
Hobbs: 960.7
TSO:

Tach:
TSN:

Complied with engine oil change. Internally inspected filter, no defects noted. Installed new CH48091-1 filter and serviced with 12 Quarts of Aeroshell 15w-50 oil.

Bro

All work performed IAW current FAA regulations and current manufacturers technical data. The work performed above is approved for return to service. For details of work performed, see workorder on file with repair station.

Signature:

Date: 03/23/2012

Work Order: S32-12-01023

For: Landmark Aviation CRS EASR436D
211 Tuskegee Road
Syracuse, NY 13211

**Landmark Aviation**

Right Engine

Reg #: N6188M
AC S/N: TH-1318
E2 M/N: IO-520-CB

Make: Beech
ACTT: 4273.0
E2 S/N: 831669R

Model: 58
Hobbs: 1027.8
TSO:

Tach: N/A
TSN:

Complied with Annual Inspection in accordance 14CFR 91.409(a)(1).
Complied with AD research thru biweekly 2012-19.
AD 95-03-13 found to no longer be applicable. Updated engine mounts installed.
Compressions; #1 58/80, #2 74/80, #3 43/80 (prior to cylinder repair), #4 67/80, #5 57/80, #6 62/80. Pressure of the day 39/80.
Complied with engine oil change. Internally inspected filter, no defects noted. Installed new CH48091-1 filter and serviced with 12 Quarts of Aeroshell 15w-50 oil.
Removed #3 cylinder due to low compression, and reinstalled after repair by Penn Yan Aero. Ref w.o. 35991. Leak and ops checks satisfactory.

All work performed IAW current FAA regulations and current manufacturers technical data. The work performed above is approved for return to service. For details of work performed, see workorder on file with repair station.

Signature:

Date: 09/29/2012

Work Order: S32-12-01196

For: Landmark Aviation CRS EASR436D
211 Tuskegee Road
Syracuse, NY 13211

**Landmark Aviation**

Right Engine

Reg #: N6188M
AC S/N: TH-1318
E2 M/N: IO-520-CB

Make: Beech
ACTT: 4322.0
E2 S/N: 831669R

Model: 58
Hobbs: 1076.8
TSO:

Tach: N/A
TSN:

Complied with engine oil change. Internally inspected filter, no defects noted. Installed new CH48091-1 filter and serviced with 12 Quarts of Aeroshell 15w-50 oil.

All work performed IAW current FAA regulations and current manufacturers technical data. The work performed above is approved for return to service. For details of work performed, see workorder on file with repair station.

Signature:

Date: 05/21/2013

Work Order: S32-13-01453

For: Landmark Aviation CRS EASR436D
211 Tuskegee Road
Syracuse, NY 13211

**Landmark Aviation**

Right Engine

Reg #: N6188M
AC S/N: TH-1318
E2 M/N: IO-520-CB

Make: Beech
ACTT: 4348.5
E2 S/N: 831669R

Model: 58
Hobbs: 1103.3
TSO:

Tach: N/A
TSN: 976.4

Complied with Annual Inspection in accordance 14CFR 91.409(a)(1).
Complied with AD research thru biweekly 2013-20.
Compressions; #1 61/80, #2 76/80, #3 64/80, #4 62/80, #5 62/80, #6 62/80. Pressure of the day 40/80.
Complied with engine oil change. Internally inspected filter, no defects noted. Installed new CH48091-1 filter and serviced with 12 Quarts of Aeroshell 15w-50 oil.

All work performed IAW current FAA regulations and current manufacturers technical data. The work performed above is approved for return to service. For details of work performed, see workorder on file with repair station.

Signature:

Date: 10/07/2013

Work Order: S32-13-01610

For: Landmark Aviation CRS EASR436D
211 Tuskegee Road
Syracuse, NY 13211



Service Information

Service Bulletins and Technical Publications are available on a direct mail basis from the factory. Orders must be prepaid. Send for order form or call 334-438-3411, publications department, for information.

Engine Returns

All returned engines are to be shipped with this log book
Directly to:

Teledyne Continental Motors
Abbeville Industrial Park
Suite 159
Abbeville, AL 36310

USE ONLY FUEL CONFORMING TO ASTM D910
USE OF AUTOMOTIVE GAS IS NOT APPROVED.



Teledyne Continental Motors, Inc.
A Teledyne Technologies Company

Printed: 05/19/2004

This engine model I0520CB9F, Serial No. 831668 - R was manufactured on 05/19/2004 by Teledyne Continental Motors in accordance with approved design data and the applicable requirements of Part 21 of the Federal Aviation Regulation. The approved design data for this engine incorporates all changes required by applicable Airworthiness Directives and Teledyne Continental Motors Service Bulletins.

C. W. Ford

TELEDYNE CONTINENTAL MOTORS
A TELEDYNE TECHNOLOGIES COMPANY
PRODUCTION CERTIFICATE NO. 508

Landmark Aviation

Left Engine

Reg #: N6188M
AC S/N: TH-1318
E1 M/N: IO-520-CB**Make:** Beech
ACTT:
E1 S/N: 831668R**Model:** 58
Hobbs: 960.7
TSO:**Tach:**
TSN:

Complied with engine oil change. Internally inspected filter, no defects noted. Installed new CH48091-1 filter and serviced with 12 Quarts of Aeroshell 15w-50 oil.

All work performed IAW current FAA regulations and current manufacturers technical data. The article is airworthy with respect to the work above.
For details of work performed, see workorder on file with repair station.

Signature: 

Date: 03/23/2012

Work Order: S32-12-01023

For: Landmark Aviation CRS EASR436D
211 Tuskegee Road
Syracuse, NY 13211

**Landmark Aviation**

Left Engine

Reg #: N6188M
AC S/N: TH-1318
E1 M/N: IO-520-CB**Make:** Beech
ACTT:
E1 S/N: 831668R**Model:** 58
Hobbs: 1005.1
TSO:**Tach:**
TSN:

Complied with engine oil change. Internally inspected filter, no defects noted. Installed new CH48091-1 filter and serviced with 12 Quarts of Aeroshell 15w-50 oil.

All work performed IAW current FAA regulations and current manufacturers technical data. The article is airworthy with respect to the work above.
For details of work performed, see workorder on file with repair station.

Signature: 

Date: 06/15/2012

Work Order: S32-12-01107

For: Landmark Aviation CRS EASR436D
211 Tuskegee Road
Syracuse, NY 13211

**Landmark Aviation**

Left Engine

Reg #: N6188M
AC S/N: TH-1318
E1 M/N: IO-520-CB**Make:** Beech
ACTT: 4273.0
E1 S/N: 831668R**Model:** 58
Hobbs: 1027.8
TSO:**Tach:** N/A
TSN:

Complied with Annual Inspection in accordance 14CFR 91.409(a)(1).
Complied with AD research thru biweekly 2012-19.
AD 95-03-13 found to no longer be applicable. Updated engine mounts installed.
Compressions; #1 71/80, #2 64/80, #3 72/80, #4 54/80 (prior to cylinder repair), #5 62/80, #6 68/80. Pressure of the day 39/80.
Complied with engine oil change. Internally inspected filter, no defects noted. Installed new CH48091-1 filter and serviced with 12 Quarts of Aeroshell 15w-50 oil.
Removed #4 cylinder due to low compression, and reinstalled after repair by Penn Yan Aero. Ref w.o. 35990. Leak and ops checks satisfactory.

All work performed IAW current FAA regulations and current manufacturers technical data. The work performed above is approved for return to service.
For details of work performed, see workorder on file with repair station.

Signature: 

Date: 09/29/2012

Work Order: S32-12-01196

For: Landmark Aviation CRS EASR436D
211 Tuskegee Road
Syracuse, NY 13211

**Landmark Aviation**

Left Engine

Reg #: N6188M
AC S/N: TH-1318
E1 M/N: IO-520-CB**Make:** Beech
ACTT: 4322.0
E1 S/N: 831668R**Model:** 58
Hobbs: 1076.8
TSO:**Tach:** N/A
TSN:

Complied with engine oil change. Internally inspected filter, no defects noted. Installed new CH48091-1 filter and serviced with 12 Quarts of Aeroshell 15w-50 oil.

All work performed IAW current FAA regulations and current manufacturers technical data. The article is airworthy with respect to the work above.
For details of work performed, see workorder on file with repair station.

Signature: 

Date: 05/21/2013

Work Order: S32-13-01453

For: Landmark Aviation CRS EASR436D
211 Tuskegee Road
Syracuse, NY 13211



Landmark Aviation

Left Engine

Reg #: N6188M
AC S/N: TH-1318
E1 M/N: IO-520-CB

Make: Beech
ACTT: 4348.5
E1 S/N: 831668R

Model: 58
Hobbs: 1103.3
TSO:

Tach: N/A
TSN: 976.4

Complied with Annual Inspection in accordance 14CFR 91.409(a)(1).

Complied with AD research thru biweekly 2013-20.

Compressions; #1 73/80, #2 63/80, #3 73/80, #4 72/80, #5 68/80, #6 46/80. Pressure of the day 40/80.

Complied with engine oil change. Internally inspected filter, no defects noted. Installed new

CH48091-1 filter and serviced with 12 Quarts of Aeroshell 15w-50 oil.

All work performed IAW current FAA regulations and current manufacturers technical data. The work performed above is approved for return to service.
For details of work performed, see workorder on file with repair station.

Signature:

Date: 10/07/2013

Work Order: S32-13-01610

For: Landmark Aviation CRS EASR436D
211 Tuskegee Road
Syracuse, NY 13211



Landmark Aviation

Left Engine

Reg #: N6188M
AC S/N: TH-1318
E1 M/N: IO-520-CB

Make: Beech
ACTT: 4380.5
E1 S/N: 831668R

Model: 58
Hobbs: 1135.3
TSO:

Tach: N/A
TSN:

Complied with engine oil change. Internally inspected filter, no defects noted. Installed new
CH48091-1 filter and serviced with 12 Quarts of Aeroshell 15w-50 oil.

All work performed IAW current FAA regulations and current manufacturers technical data. The article is airworthy with respect to the work above.
For details of work performed, see workorder on file with repair station.

Signature:

Date: 05/14/2014

Work Order: S32-14-01865

For: Landmark Aviation CRS EASR436D
211 Tuskegee Road
Syracuse, NY 13211

